

Exam Questions 300-615

Troubleshooting Cisco Data Center Infrastructure (DCIT)

<https://www.2passeasy.com/dumps/300-615/>



NEW QUESTION 1

A vPC Type-1 inconsistency between two vPC peers in a VXLAN EVPN setup is discovered. Which two actions need to be attempted to resolve the issue? (Choose two.)

- A. Configure the NVE interfaces to be Up on both switches.
- B. Set a different distributed gateway virtual MAC address.
- C. Set a different secondary IP addresses on NVE source-interface.
- D. Configure the same VNI to multicast group mapping.
- E. Set a different primary IP addresses on NVE source-interface.

Answer: AD

NEW QUESTION 2

Refer to the exhibit. The HSRP configuration in the exhibit fails to function. Which action resolves this issue?

- A. Enable IP redirects.
- B. Set the MTU to 1500 bytes.
- C. Configure HSRP version 2.
- D. Configure the same HSRP group on both devices.

Answer: A

NEW QUESTION 3

An engineer removes a VMM domain from an endpoint group called EPG-1, but the distributed port group fails to be deleted. Which action must be taken to resolve the issue?

- A. Remove the port group manually.
- B. Migrate all virtual machines in the EPG-1 to different hypervisors.
- C. Remove the remaining EPGs from the VMM domain.
- D. Migrate all virtual machines in the EPG-1 to different port groups.

Answer: C

NEW QUESTION 4

```
Nexus7K-1# show configuration interface
vlan50
interface Vlan50
  no shutdown
  ip address 10.35.164.2/25
  hsrp version 2
  hsrp 50
    preempt
    priority 150
    ip 10.35.164.1


Nexus7K-2# show configuration interface
vlan50
interface Vlan50
  no shutdown
  ip address 10.35.164.3/25
  hsrp 50
    preempt
    priority 50
    ip 10.35.164.1
```

Refer to the exhibit. HSRP adjacency fails to form between Nexus7K-1 and Nexus7K-2. Which action should be taken to solve the problem?

- A. Configure preempt on one of the switches in the HSRP group.
- B. Configure the same HSRP priority between the two switches.
- C. Configure the correct subnet mask on Nexus7K-1.
- D. Configure HSRP version 2 on Nexus7K-2.

Answer: D

NEW QUESTION 5

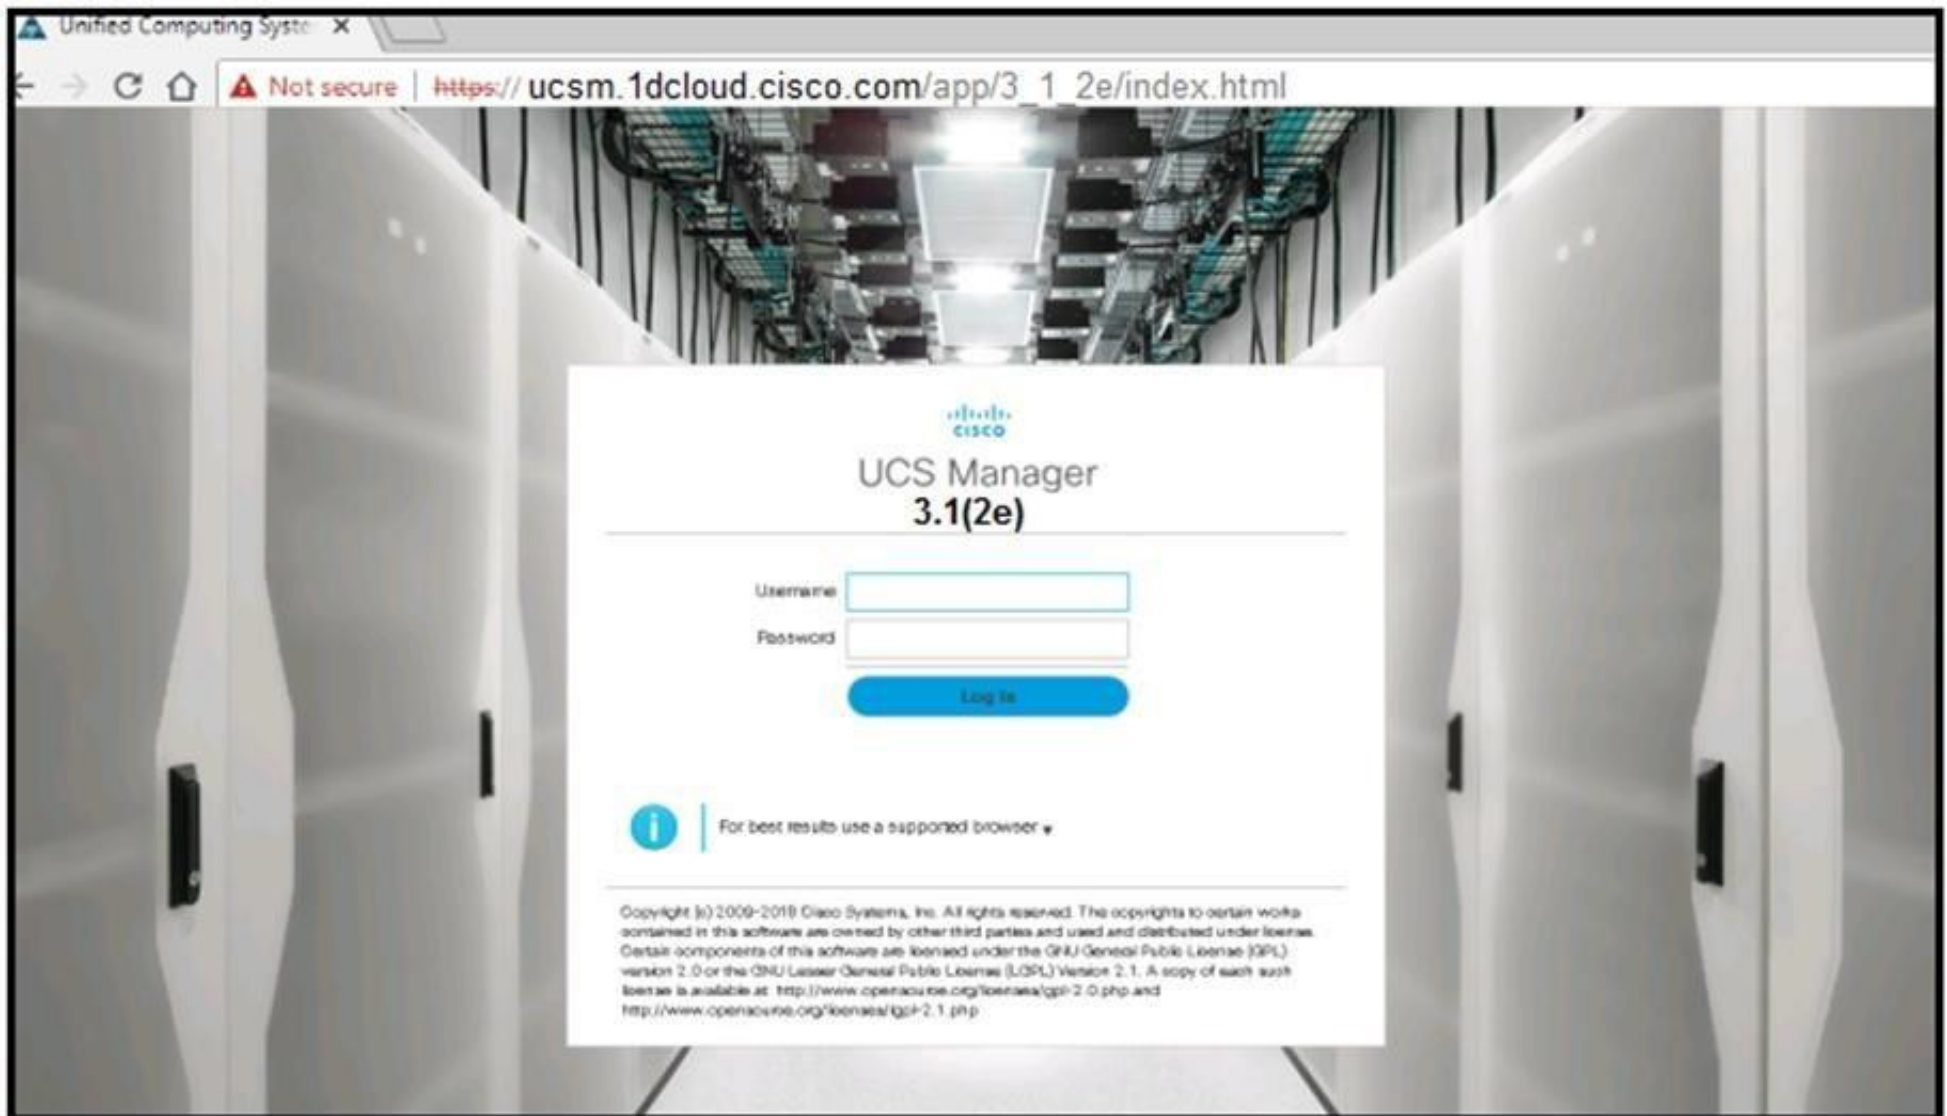

Refer to the exhibit. A web browser displays a “not secure” warning message when accessing the web interface of Cisco UCS Manager. Which action resolves the issue?

- A. Load third-party certificate to UCS Manager.
- B. Use the correct TCP port for HTTPS.
- C. Use a supported web browser.
- D. Use a supported version of UCS Manager.

Answer: A

NEW QUESTION 6

An engineer must replace a failed memory on a Cisco UCS B-Series Blade Server. After the replacement was done, the server has a “resolve slot” warning. Which server maintenance action resolves the issue?

- A. Perform diagnostic interrupt on the server.
- B. Re-acknowledgement the server.
- C. Reset the server.
- D. Decommission the server.

Answer: B

NEW QUESTION 7

DRAG DROP

Drag and drop the commands from the left onto the correct categories on the right.

Select and Place:

- A. Mastered
- B. Not Mastered

Answer: A

NEW QUESTION 8

```
switch# guestshell resize cpu 4
Note: System CPU share will be resized on Guest shell enable
```

Refer to the exhibit. After the configuration is performed, guestshell continues to use 2%CPU. Which action resolves the issue?

- A. Resync the database
- B. Recreate the guestshell
- C. Reboot the guestshell
- D. Reboot the switch

Answer: C

NEW QUESTION 9

A request to activate the port security database is rejected. Which action do you perform to investigate the cause of the issue?

- A. Enable the auto-learning feature.
- B. Use the force option to identify rejected devices.
- C. Find conflicting entries between the active and configuration databases.
- D. Verify that devices are fully attached to the active database.

Answer: B

NEW QUESTION 10

An IOM fails during a firmware upgrade and is unresponsive. Which action recovers the module?

- A. Restore UCSM configuration from backup.
- B. Roll back to the previous firmware.
- C. Use AutoInstall to reinstall the firmware.
- D. From the peer IOM, reset the faulty module.

Answer: B

NEW QUESTION 10

After upgrading a client's fabric interconnect to the latest version, an engineer discovers that the appliance has lost its entire configuration. Which two locations should an engineer check to confirm that the appliance had backed up the configuration prior to the upgrade in order to retrieve the lost configuration? (Choose two.)

- A. Equipment FSM page, InternalBackup stage
- B. Service profiles page, InternalBackup stage
- C. Admin page, PollInternalBackup stage
- D. Equipment FSM page, PollInternalBackup stage
- E. Admin page, InternalBackup stage.

Answer: AC

NEW QUESTION 12

.....

THANKS FOR TRYING THE DEMO OF OUR PRODUCT

Visit Our Site to Purchase the Full Set of Actual 300-615 Exam Questions With Answers.

We Also Provide Practice Exam Software That Simulates Real Exam Environment And Has Many Self-Assessment Features. Order the 300-615 Product From:

<https://www.2passeasy.com/dumps/300-615/>

Money Back Guarantee

300-615 Practice Exam Features:

- * 300-615 Questions and Answers Updated Frequently
- * 300-615 Practice Questions Verified by Expert Senior Certified Staff
- * 300-615 Most Realistic Questions that Guarantee you a Pass on Your FirstTry
- * 300-615 Practice Test Questions in Multiple Choice Formats and Updatesfor 1 Year